

the certification requirements in § 63.7700(b) or with the procedures in your scrap selection and inspection plan required in § 63.7700(c). Your records documenting compliance with the scrap selection and inspection plan must include a copy (kept onsite) of the procedures used by the scrap supplier for either removing accessible mercury switches or for purchasing automobile bodies that have had mercury switches removed, as applicable.

(b) You must keep records of the chemical composition of all catalyst binder formulations applied in each furan warm box mold or core making line at a new or existing iron and steel foundry to demonstrate continuous compliance with the requirements in § 63.7700(d).

(c) For a scrap preheater at an existing iron and steel foundry, you must operate and maintain each gas-fired preheater such that the flame directly contacts the scrap charged to demonstrate continuous compliance with the requirement § 63.7700(e)(1). If you choose to meet the work practice standard in § 63.7700(e)(2), you must keep records to document that the scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b).

(d) For a scrap preheater at a new iron and steel foundry, you must keep records to document that each scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b) to demonstrate continuous compliance with the requirement in § 63.7700(f).

§ 63.7745 How do I demonstrate continuous compliance with the operation and maintenance requirements that apply to me?

(a) For each capture system and control device for an emissions source subject to an emissions limit in § 63.7690(a), you must demonstrate continuous compliance with the operation and maintenance requirements of § 63.7710 by:

(1) Making monthly inspections of capture systems and initiating corrective action according to § 63.7710(b)(1) and recording all information needed

to document conformance with these requirements;

(2) Performing preventative maintenance for each control device according to the preventive maintenance plan required by § 63.7710(b)(3) and recording all information needed to document conformance with these requirements;

(3) Operating and maintaining each bag leak detection system according to the site-specific monitoring plan required by § 63.7710(b)(4) and recording all information needed to demonstrate conformance with these requirements;

(4) Initiating and completing corrective action for a bag leak detection system alarm according to the corrective action plan required by § 63.7710(b)(5) and recording all information needed to document conformance with these requirements; and

(5) Igniting gases from mold vents according to the procedures in the plan required by § 63.7710(b)(6). (Any instance where you fail to follow the procedures is a deviation that must be included in your semiannual compliance report.)

(b) You must maintain a current copy of the operation and maintenance plans required by § 63.7710(b) onsite and available for inspection upon request. You must keep the plans for the life of the iron and steel foundry or until the iron and steel foundry is no longer subject to the requirements of this subpart.

§ 63.7746 What other requirements must I meet to demonstrate continuous compliance?

(a) *Deviations.* You must report each instance in which you did not meet each emissions limitation in § 63.7690 (including each operating limit) that applies to you. This requirement includes periods of startup, shutdown, and malfunction. You also must report each instance in which you did not meet each work practice standard in § 63.7700 and each operation and maintenance requirement of § 63.7710 that applies to you. These instances are deviations from the emissions limitations, work practice standards, and operation and maintenance requirements in this subpart. These deviations must be reported according to the requirements of § 63.7751.